



TEST REPORT

Reference No. : WTS17F0271006C

Applicant : SHUN TAI PRECISION RUBBER (Shenzhen)CO., LTD

Address : NO.54 Fujian Road, Guanlan Yuexingwei Community, Longhua New District, Shenzhen, China

Sample Name : SIR

Test Requested : In accordance with Food and Drug Administration Regulations to test the following items
— Test for compliance with US FDA 21 CFR Part 177.2600

Test Conclusion : **Pass** (Please refer to next pages for details)

Date of Receipt sample : 2017-02-18

Date of Test : 2017-02-18to 2017-02-24

Date of Issue : 2017-03-02

Test Result : Please refer to next page (s)

Remarks:

The results shown in this test report refer only to the sample(s) tested, this test report cannot be reproduced, except in full, without prior written permission of the company. The report would be invalid without specific stamp of test institute and the signatures of compiler and approver.

Prepared By:

Waltek Services (Foshan) Co., Ltd.

Address: No. 13-19, 2/F, 2nd Building, Sunlink International Machinery City, Chencun Town, Shunde District, Foshan, Guangdong, China
Tel :+86-757-23811398
Fax:+86-757-23811381

Compiled by:

Humour Wu

Humour.Wu / Project Engineer

Approved by:



Jackson Zhou

Jackson.Zhou / Lab Manager

**Test Results:****Test for compliance with US FDA 21 CFR Part 177.2600**

| Simulant | Time | Temperature | Result (mg/in ²) | MDL(mg/in ²) | Limit(mg/in ²) |
|-----------------|--------------------|--------------------|------------------------------|--------------------------|----------------------------|
| | | | No.1 | | |
| Distilled water | 7 hours | Reflux temperature | ND | 0.5 | 20 |
| | Succeeding 2 hours | Reflux temperature | ND | 0.5 | 1 |
| n-Hexane | 7 hours | Reflux temperature | 8.5 | 0.5 | 175 |
| | Succeeding 2 hours | Reflux temperature | ND | 0.5 | 4 |

Note:


1. "mg/in²" = milligram per square inch
2. MDL= Method Detection Limit
3. ND = Not Detected, less than MDL
4. The specification was quoted from US FDA 21 CFR Part 177.2600.




WALTEK



Sample Photo:

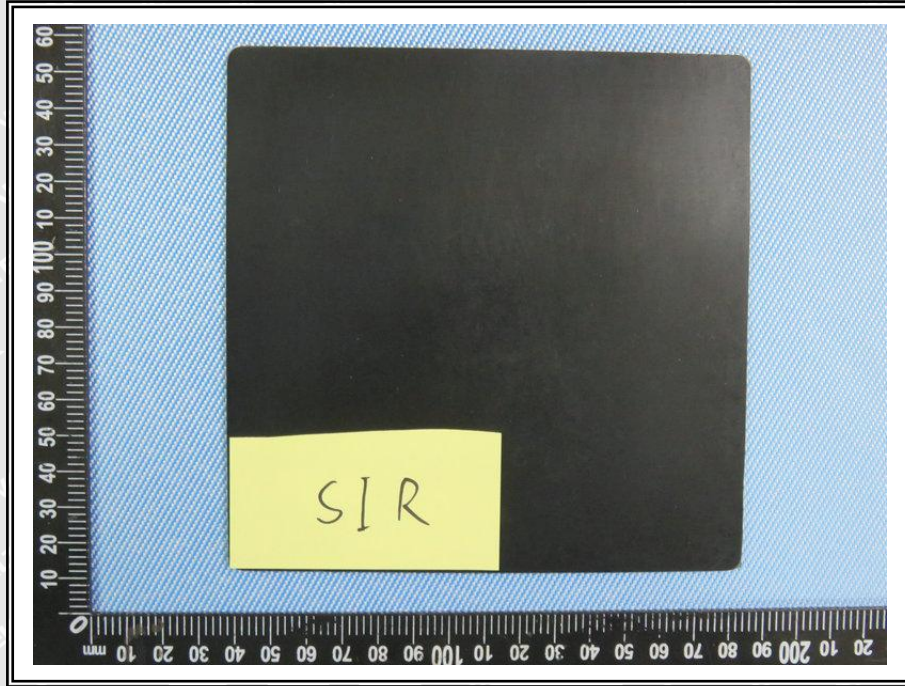

Photograph of parts tested:
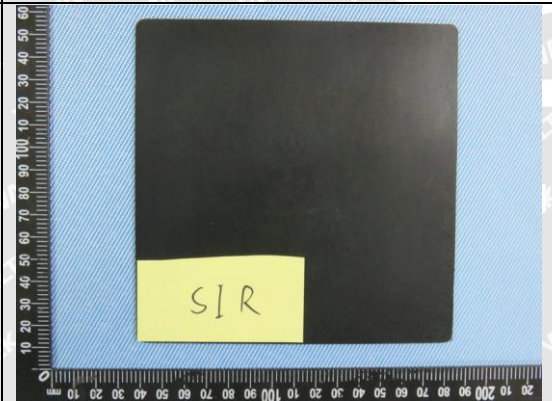
| No. | Photo of testing part | Parts Description | Client Claimed Material |
|-----|---|-------------------|-------------------------|
| 1 |  | Black rubber | Rubber |

===== End of Report =====